

RIVER MURRAY FLOW REPORT and WATER RESOURCES UPDATE

Public I2 A2

Report #37/2018

Issued 10:00 am 14 September 2018

This supersedes the previous flow report issued by the Department for Environment and Water (DEW) on 7 September 2018. The next report will be provided on Friday 21 September 2018.

In this report, for ease of representation, large volumes of water are expressed in gigalitres (GL), while smaller volumes are expressed in megalitres (ML). One GL is equal to 1 000 ML.

MANAGEMENT OF SOUTH AUSTRALIA'S DEFERRED WATER

The Murray-Darling Basin Authority confirmed that on 1 September 2018 South Australia had 260.6 GL of deferred water held in storage. The table below identifies the storage in which it is held and the purpose.

At 1 September 2018				
Purpose	Lake Victoria (GL)	Hume (GL)	Dartmouth (GL)	Total (GL)
*CHWN	0	0.0	157.9	157.9
Private Carryover	0	0.0	102.7	102.7
Total	0	0.0	260.6	260.6

*Critical Human Water Needs (CHWN)

Volumes stored are adjusted for net evaporation losses and spills until delivered to South Australia. South Australia is seeking opportunities to defer and store water during 2018-19.

WATER RESOURCES UPDATE

During August 2018, the total River Murray System inflow was approximately 565 GL, which is approximately 35% of the August long-term average of 1 592 GL. There was no inflow to Menindee Lakes (from the Darling System) during August 2018, compared to the August long-term average of 182 GL.

The flow to South Australia during August 2018 was approximately 175 GL, which is about 20% of the August long-term average of approximately 860 GL. The flow comprised:

- 124 GL of Entitlement Flow (includes environmental water on SA licence); plus
- 51 GL of environmental water.

RAINFALL AND TEMPERATURE OUTLOOK

The latest Bureau of Meteorology weather outlook for September to November 2018 indicates below average rainfall with warmer than average temperatures across the Murray-Darling Basin. The outlook is influenced by El Niño Watch, which means the chance of El Niño forming in 2018 is double the normal chance. El Niño conditions usually bring drier than normal conditions across the Murray-Darling Basin.

RIVER MURRAY SYSTEM WATER DELIVERY SHORTFALL RISKS

Water delivery shortfalls are rare but occur when available water cannot be delivered to users when they want it. For example, it could happen because demand exceeds the physical capacity of rivers and channels to carry the water, or when demands for water unexpectedly spike and there's not enough time to release additional water from upstream reservoirs to meet the demand.

Water holders along the River Murray, especially downstream of the Barmah Choke (which is located upstream of Echuca in Victoria and Deniliquin in NSW), need to understand the risk of a water delivery shortfall and take



River Murray Flow Report and Water Resources Update

it into account in business planning and investment decisions. For more information about water delivery shortfall see the factsheet on the MDBA's website [RM water delivery shortfall risk factsheet](#)

STORAGE VOLUMES

Murray-Darling Basin Storage Volumes

Storage	Full Supply Volume (GL)	12/9/2018 (GL)	12/9/2017 (GL)	Long-term average (end of September) (GL)
Dartmouth	3 856	3 406 (88%)	3 198 (83%)	
Hume	3 003	1 590 (53%)	2 720 (91%)	
Lake Victoria	677	349 (51%)	607 (90%)	
Menindee Lakes	*1 731	170 (10%)	696 (40%)	
TOTAL	9 267	5 515 (60%)	7 221 (78%)	

*Menindee Lakes can be surcharged to 2 015 GL


WATER QUALITY - Salinity

A number of targets are identified under the Basin Plan, which all Basin States must have regard to in managing River Murray flows. The targets for real-time salinity are identified below. Salinity must not exceed these values for 95% of the time:

- 580 EC at Lock 6
- 800 EC at Morgan
- 830 EC at Murray Bridge
- 1 000 EC at Milang

The following graph shows the salinity at these locations and the flow to South Australia (QSA) from September 2017 to September 2018. The dashed-lines identify the Basin Plan (BP) thresholds for the corresponding colour coded location.

SA River Murray Daily Average Salinity

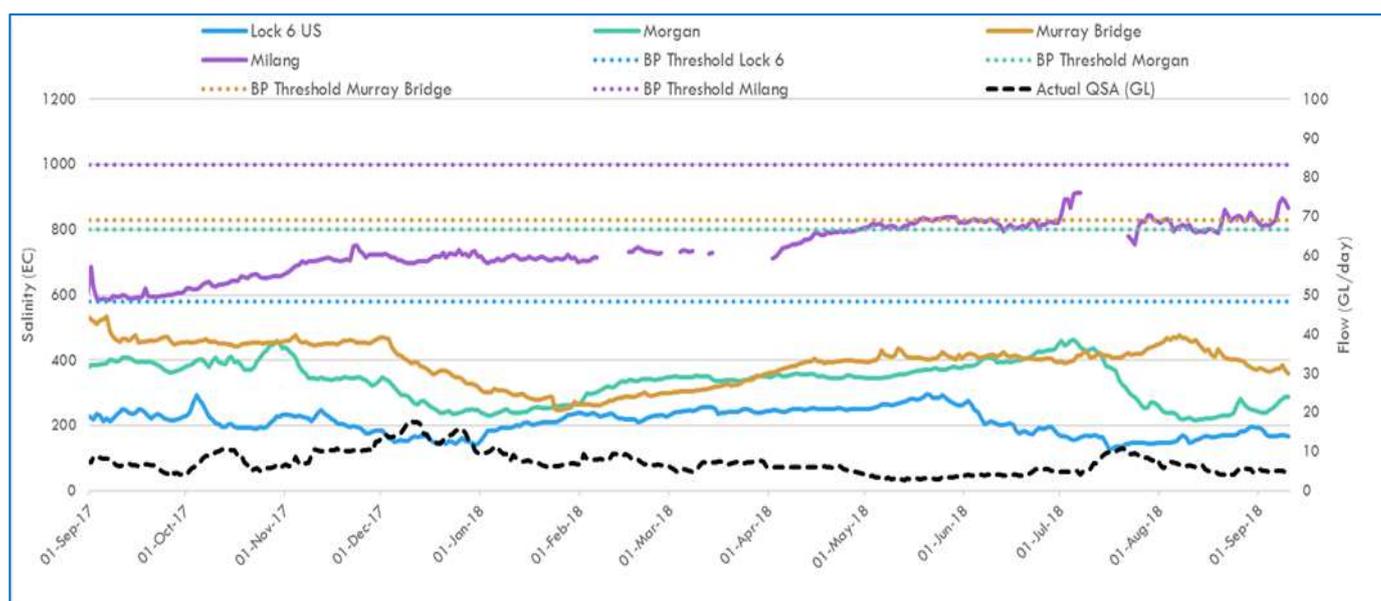

Note: Missing Milang salinity readings periodically during February, March, April and July 2018 are due to biofouling at the EC sensor

FLOW OUTLOOK

The flow at the South Australian border is approximately 5.5 GL/day and will remain around this rate during the coming week. It comprises:

- normal September Entitlement Flow of 4.5 GL/day;
- less deferred water;
- plus environmental water; and
- interstate trade adjustments.

The flow over Lock 1 is approximately 3.5 GL/day and will remain around this rate during the coming week, depending on weather conditions and extractions.

It is important to note that flow forecasts in this advice are based on the information available at the time of preparation. Advice may change as new gauging information becomes available, or due to rainfall events or changed operations upstream. The forecasts will be revised as new information becomes available.

ENVIRONMENTAL WATER

Small volumes of environmental water are being delivered to South Australia to meet specific environmental watering objectives, given the dry conditions. Environmental water is being delivered for the operation of the Chowilla Environmental Regulator to create an in-channel rise in Chowilla Creek and connected anabranches. The water level in the Lock 6 weir pool is in the process of being raised by about 0.20 m above normal pool level to assist the Chowilla operations. Inundation will remain mostly within creek banks. Environmental water is also contributing to weir pool raising events at Locks 2 and 5.

Environmental water is also being delivered to the Lower Lakes for barrage releases to maintain connectivity between Lake Alexandrina and the Coorong estuary and to store water for watering actions in warmer months.

MURRAY MOUTH

Dredging operations at the Murray Mouth commenced on 9 January 2015 to maintain connectivity (exchange of water) between the Coorong and the Southern Ocean.

Two dredges are currently operating 24/7 in the Goolwa and Tauwitchere channels. At 9 September 2018, a total of approximately 3 453 070 cubic metres of sand had been removed by dredging operations. Recent barrage releases combined with dredging have helped to maintain connectivity of the Murray Mouth.

There are a number of shallow zones in and adjacent to the Murray Mouth. Mariners should use caution when traversing the mouth area, follow all directions, reduce speed and avoid travelling at low tide. Boats equipped with echo sounders should check depths regularly. Mariners are reminded that navigation through the Murray Mouth is only permitted during daylight hours and that Exclusion Zones established around the dredging operations are in place to ensure public safety. Refer to Notice to Mariners No 42 of 2016 [Notice 42](#)

There is a partial park closure in place for the northern tip of the Coorong National Park. For more information visit [Coorong partial park closure notice](#)

BARRAGE OPERATIONS AND WATER LEVELS IN THE LOWER LAKES

The water level in Lake Alexandrina is approximately 0.76 m AHD and Lake Albert is approximately 0.84 m AHD. The difference in water level is due to wind effects. When possible, water levels are being managed to achieve a target water level of around 0.75 m AHD by the end of September.

During the week ending 11 September 2018 total barrage releases were approximately 9 GL. All fishways remain open. During adverse weather conditions SA Water will operate the barrages to minimise the risk of seawater entering Lake Alexandrina, therefore minimising any negative salinity impacts from reverse flow events.

River Murray Flow Report and Water Resources Update

Water levels and barrage operations are monitored closely by the South Australian Government, Murray-Darling Basin Authority and Commonwealth Environmental Water Office.

WEIR POOL OPERATIONS

The Normal Pool Level (NPL) and Normal Operating Range (NOR) for the South Australian locks and weirs are identified in the table below.

Weir	Normal Pool Level (NPL) m AHD	Normal Operating Range (NOR) m AHD
Lock 6 - Murtho	19.25	19.17 - 19.50
Lock 5 - Renmark	16.30	16.22 - 16.43
Lock 4 – Bookpurnong	13.20	13.16 - 13.50
Lock 3 - Overland Corner	9.80	9.77 - 10.02
Lock 2 – Waikerie	6.10	6.02 - 6.40
Lock 1 – Blanchetown	3.20	3.10 - 3.50

Chowilla Regulator and Weir and Lock 6

An 'in-channel rise' operation of the Chowilla Environmental Regulator commenced on 20 August 2018. This involves a low level operation of the Chowilla Regulator to raise water levels in Chowilla Creek and through the anabranche by between approximately 1.6 m to 2.0 m above NPL (to 18 m AHD to 18.4 m AHD). Inundation will remain mostly within creek banks with some water entering low lying flow paths and wetlands.

Raising the water level in the Lock 6 weir pool is also being undertaken in conjunction with the Chowilla Regulator operation. Raising the weir pool commenced on 10 September 2018 and will continue to be raised slowly until the water level is approximately 0.20 m above NPL (19.45 m AHD).

Boat access in Chowilla Creek through the Chowilla Regulator will be closed for the period of the regulator operation. Access is still available upstream and downstream of the regulator – for more information see [Chowilla Floodplain](#) then scroll down to *related links* – Chowilla Operations 2018.

Weir and Lock 5

Raising the water level in the Lock 5 weir pool has reached the target water level of 16.65 m AHD (0.35 m above NPL). This water level will be held for a short period before being lowered slowly to the NPL.

Weir and Lock 2

Raising the water level in the Lock 2 weir pool has reached the target water level of 6.60 m AHD (0.50 m above NPL). This water level will be held for a short period before being lowered slowly to the NPL.

To receive real-time SMS updates on weir pool manipulation actions please text or call DEW River Murray Operations on 0438 539 271 and indicate what weir pool reach you are interested in receiving updates for. If you have questions relating to river operations generally, please also use this mobile number.

NAVIGATION ISSUES

SA Water is undertaking maintenance work on the Lock 3 chamber. This work is expected to be completed next week.

Sandbars in the vicinity of the Murray Mouth may cause navigation hazards. Mariners are advised to navigate with caution when operating in the area. Sandbars are also present along sections of the River Murray downstream of Locks 7 and 8 and in South Australia. All Mariners should be aware of the risk of submerged navigation hazards, and should regularly check river depth.

BERRI RIVER VESSEL WASTE DISPOSAL STATION

The Berri River Vessel Waste Disposal Station is temporarily closed for upgrade works. The works are expected to be completed around 15 November 2018.

A free temporary pump-out service is available 330 metres upstream of the existing facility, adjacent to the Berri Rowing Club. The location is sign-posted. River vessel users must call Dennis Kuhn of Kuhn Plumbing Service on 0400 480 203 or 8588 2678 to arrange a suitable time to pump-out waste (please note **4 hours notice is essential**). Pump-outs can be arranged between 8:00 am and 4:00 pm daily.

If you have any enquiries about the upgrade please call Mr Hayden Smith, Infrastructure Project Officer, on 0457 820 553.

RIVERINE RECOVERY CONSTRUCTION WORKS

The Riverine Recovery Project is in the process of constructing environmental regulators to manage a number of wetlands between Mannum and Murtho. Construction is expected to be completed by the end of February 2019. Construction works have commenced at Big Bend, Sugar Shack, Pyap, Murtho-Wiela, North Caurnamont, Silverlea, Teal Flat Hut and Woolenook Bend Wetlands. During the coming months work will commence at Teal Flat and Goat Island Paringa Paddock Wetlands.

SOUTH AUSTRALIAN RIVERLAND FLOODPLAINS INTEGRATED INFRASTRUCTURE PROGRAM (SARFIIP) CONSTRUCTION WORKS

The construction of regulating structures and a blocking bank on the Pike Floodplain has commenced. The works are expected to be completed by December 2019. The works will enable:

- a portion of the floodplain to be inundated more regularly to improve ecological health; and
- fish to move freely between the River Murray and the floodplain.

During the construction period, for safety reasons, vessels and persons other than those participating in the works are prohibited from entering the Pike River near the Rumpagunyah Creek and Tanyaca Creek junction, downstream of the Mundic Creek junction.

River Murray Flow Report and Water Resources Update

RIVER MURRAY WATER LEVELS

Below is a table of River Murray water levels at a number of locations from Lock 10 to Murray Bridge.

River Murray Water Levels

Location	River km	Normal Pool Level (m AHD)	Current Level 12/9/2018 (m AHD)	1974 Flood Level (m AHD)	1993 Flood Level (m AHD)	2016 High Water Level (m AHD)
Lock 10	825.0	30.80	30.90	33.81	33.32	32.72
Lock 9 Kulnine	764.8	27.40	27.34	30.03	29.44	28.85
Lock 8 Wangumma	725.7	24.60	24.25	27.60	27.19	26.85
Lock 7 Rufus River	696.6	22.10	22.19	25.70	25.24	24.97
Lock 6 Murtho	619.8	19.25	19.34	21.03	20.50	20.19
Renmark	567.4	-	16.65	18.54	18.04	17.44
Lock 5	562.4	16.30	16.65	18.07	17.50	17.05
Lyrup	537.8	-	13.25	16.85	16.26	15.80
Berri	525.9	-	13.20	15.81	15.74	15.21
Lock 4	516.2	13.20	13.22	15.65	15.08	14.73
Loxton	489.9	-	10.00	15.05	14.12	13.54
Cobdogla	446.9	-	9.80	13.44	12.38	11.59
Lock 3	431.4	9.80	9.78	13.16	12.02	10.98
Overland Corner	425.9	-	6.70	12.73	11.58	10.41
Waikerie	383.6	-	6.71	11.26	10.24	9.20
Lock 2	362.1	6.10	6.58	10.28	9.30	8.32
Cadell	332.6	-	3.27	9.17	8.08	7.01
Morgan	321.7	-	3.23	8.85	7.65	6.38
Lock 1 Blanchetown	274.2	3.20	3.18	6.81	5.38	4.46
Swan Reach	245.0	0.75	0.86	6.06	4.51	3.11
Mannum PS	149.8	0.75	0.83	3.15	1.90	1.33
Murray Bridge	115.3	0.75	0.77	2.06	1.26	1.04

Note that the above water levels may be affected by local wind conditions



FURTHER INFORMATION

The WaterConnect website is South Australia's comprehensive water information portal and can be accessed at [Home page](#)

Up-to-date River Murray salinity, flow and water level information can be accessed at the Department for Environment and Water, SA Water and Murray-Darling Basin Authority websites

- [Water allocation and carryover announcements](#)
- [River Murray real-time water data](#)
- [SA Water River Murray info - levels, flows etc.](#)
- [Murray-Darling Basin real-time water data](#)

The latest news, information and announcements about the River Murray and Basin Plan are available at [River Murray Update](#).

The Department for Environment and Water has published a series of inundation maps for the River Murray. They are available at [River Murray Inundation Maps](#)

Information on the management of acid drainage water in the Lower River Murray can be accessed at [Acid drainage water LMRIA](#)

Details of river height and rainfall information in the River Murray within Victoria and New South Wales are available at the Bureau of Meteorology website

[Victoria rainfall and river conditions](#)

[NSW rainfall and river conditions](#)

Information provided by the Commonwealth Environmental Water Office can be accessed at [CEWH Environmental Watering](#)

Information on The Living Murray can be accessed at [MDBA TLM](#)

Chowilla Floodplain Icon Site management [Chowilla-floodplain](#)

Department for Environment and Water [Home page](#)

Information provided by the Department of Planning, Transport and Infrastructure on boat licences, registering motor boats, owning and operating water craft, and boat and marine safety can be accessed at [Boating and marine](#)

ID	RM-Flow-Report 20180914
Classification	Public I2 A2
Issued	14 September 2018
Authority	DEW
Master Document Location	R:\Water Group\RMO\WRO\04 Communications\Flow Advices\2018-19
Managed and Maintained by	River Murray Operations
Author	River Murray Operations
Reviewer	Director, River Murray Operations, Water Group